


Kugelrasten

Spring stops

Butées à ressort

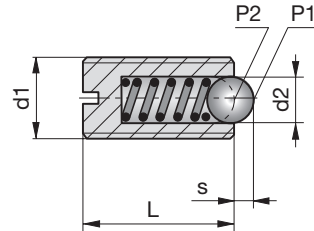


Z3152-

max. 100 °C
Mat.: 1.0715

Z3152-d1



d1	L	s	d2	P1 (N)	P2 (N)
M5	12	0,9	3,0	7	13
M6	14	1,0	3,5	9	15
M8	16	1,5	5,0	15	30
M10	19	2,0	6,0	20	35
M12	22	2,5	8,0	30	55
M16	24	3,0	10,0	65	125

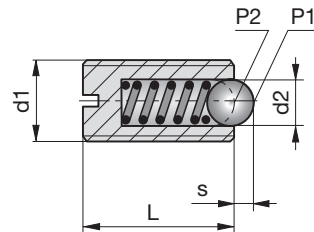

Z3154-

max. 250 °C
Mat.: 1.0715

Z3154-d1



d1	L	s	d2	P1 (N)	P2 (N)
M3	7	0,5	1,5	2	3
M4	9	0,8	2,5	8	16
M5	12	0,9	3,0	7	13
M6	14	1,0	3,5	9	15
M8	16	1,5	5,0	15	30
M10	19	2,0	6,0	20	35
M12	22	2,5	8,0	30	55
M16	24	3,0	10,0	65	125